


Application: 2009-2014 Acura Vehicles with 3.7L or 3.5L V6 engines 2008-2011 Honda Vehicles with 3.5L Engines


- ▶ **Symptom:**
Failure of the vehicle's alternator.
- ▶ **Cause:**
Look for any oil residue on the alternator.
- ▶ **The Solution:**
Replace the VTEC assembly.

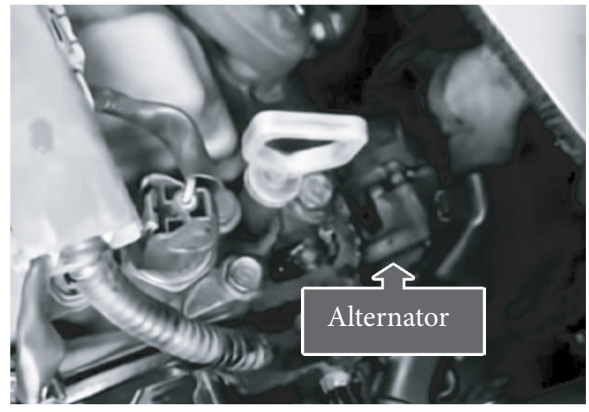

Alternator failure may be due to an engine oil leak!

CAUTION: PREVENT REPEAT ALTERNATOR FAILURE!
Alternator failure may be due to an engine oil leak! On many vehicles, the VTEC assembly is located directly above the dipstick and alternator.

If the VTEC gasket has failed, this is the source of your oil leak and alternator failure. Honda TSB 20-023 recommends replacing the VTEC assembly as a kit, part # 15810-R70-A04. Labor time: 0.8 hr. Do it today!

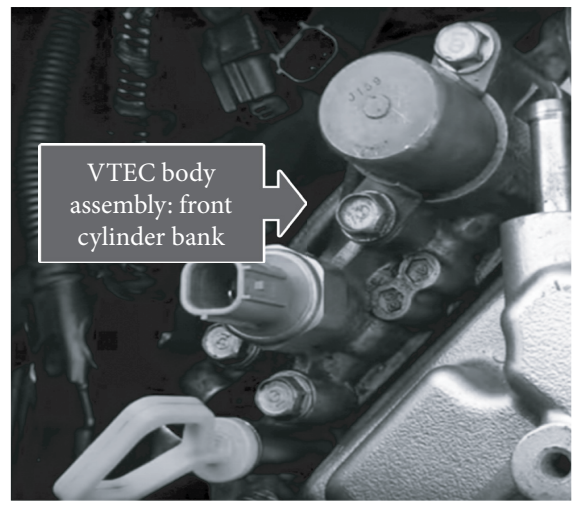

WARNING:
***FLUID CONTAMINATION WILL VOID YOUR WARRANTY.**

**TECHNICAL SUPPORT
800-228-9672**
ASE Certified Technicians are Standing by 7 days a week.



motorcar parts of america, inc.
motorcarparts.com

